

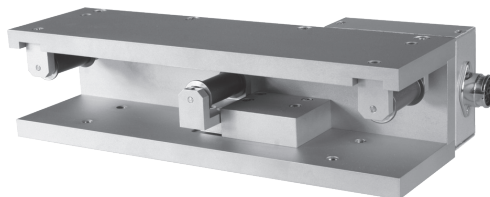
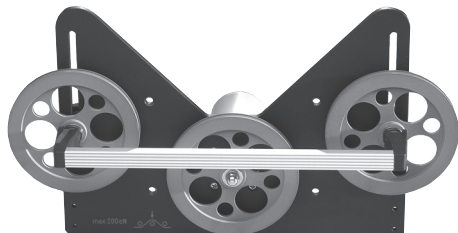
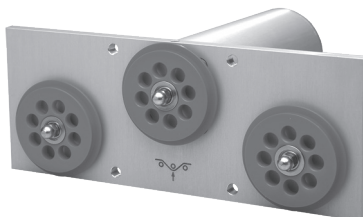
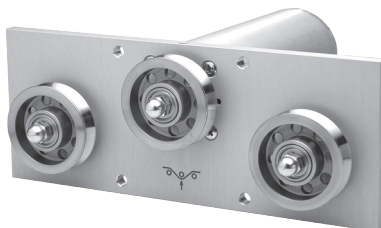


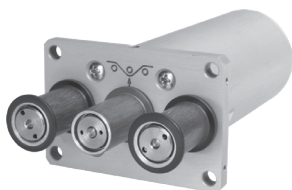

Model TS1
TSP
TSH
TSL
TSF
TSF1
TSW
TSB1
TSB2

Instruction Manual

Valid as of: 01.01.2013 • Please keep the manual for future reference!

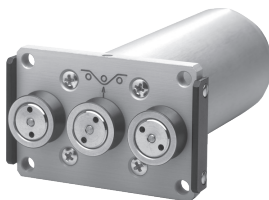

Contents

1	Warranty and liability	3
1.1	Notices within the instruction manual.....	3
1.2	Responsibilities of the operating company.....	3
1.3	Responsibilities of the personnel	3
1.4	Informal safety measures.....	4
1.5	Training of the personnel	4
1.6	Intended use	4
1.7	Dangers in handling the device.....	4
1.8	Copyright.....	4
1.9	Declaration of conformity, RoHs II and WEEE registration	4
2	Available models	5
2.1	General information.....	5
2.1.1	Available TS1 models.....	5
2.1.2	Available TSP models	6
2.1.3	Available TSH models	7
2.1.4	Available TSW models	8
2.1.5	Available TSL models.....	8
2.1.6	Available TSF models.....	9
2.1.7	Available TSF models.....	9
2.1.8	Available TSB1 models	10
2.1.9	Available TSB2 models	10
2.2	Specifications of the TS series.....	11
2.3	Assignment of the connector.....	12
2.3.1	Connecting the tension meter.....	12
2.4	Optional accessories.....	13
2.5	Delivery includes	13
2.6	Unpacking	13
3	Operating procedure	13
3.1	Initial setup	14
3.2	Internal adjustment of the sensors	14
3.2.1	Zero adjustment.....	14
3.2.2	Gain adjustment	15
4	Service and maintenance.....	16
4.1	Rollers	16
5	Cleaning.....	16
6	Verification interval	16
6.1	Verification of calibration and determination of repair costs	17
7	Correspondence	18
8	Repairs.....	18

1 Warranty and liability

In principle, the supply of the device is subject to our “General Conditions of Sale and Delivery.” These have been provided to the operating company on conclusion of the contract, at the latest.

Warranty:

- SCHMIDT tension meters are warranted for 12 months.
- Parts subject to wear, electronic components and measuring springs are not covered by the warranty. No warranty or liability will be accepted for bodily injury or property damage resulting from one or several of the following causes:
 - Misuse or abuse of the device.
 - Improper mounting, commissioning, operation and maintenance of the device (e.g. verification interval).
 - Operation of the device if any safeguards are defective or if any safety and protection precautions are not properly installed or not operative.
 - Failure to comply with the notices in the instruction manual regarding transport, storage, mounting, commissioning, operation, maintenance and setup of the device.
 - Any unauthorized structural alteration of the device.
 - Insufficient inspection of device components that are subject to wear.
 - Opening the device or improper repair work.
 - Disasters caused by the effects of foreign objects or by force majeure.

1.1 Notices within the instruction manual

The fundamental prerequisite for the safe handling of this device and its troublefree operation is the knowledge of the basic safety notices and safety instructions.

This instruction manual contains the most important notices for the safe operation of the device.

This instruction manual, in particular the safety notices, must be observed by any person who works with the device. In addition, the local valid rules and regulations for the prevention of accidents must be complied with.

The representations within the instruction manual are not true to scale.

The dimensions given are not binding.

General indications of direction, such as FRONT, REAR, RIGHT, LEFT apply when viewing the front of the device.

1.2 Responsibilities of the operating company

In compliance with the EC Directive 89/655/EEC, the operating company agrees to only permit persons to work with the device who:

- are familiar with the basic regulations on industrial safety and accident prevention and who have been trained in handling the device.
- have read and understood the chapter on safety and the warning notices in these instruction manual and have confirmed this with their signatures.
- are examined regularly on their safe and conscientious working method.

1.3 Responsibilities of the personnel

All persons who work with the device agree to perform the following duties before starting work:

- to observe the basic regulations on industrial safety and accident prevention.
- to read the chapter on safety and the warning notices in these instruction manual and to confirm with their signatures that they have understood them.

1.4 Informal safety measures

The instruction manual must always be kept on hand where the device is operated. Apart from the instruction manual, the general and local valid regulations on accident prevention and environmental protection must be provided and complied with.

1.5 Training of the personnel

Only trained and instructed personnel is permitted to work with the device. The responsibilities of the personnel must be clearly defined for mounting, commissioning, operation, setup, maintenance, and repair. Trainees may only work with the device under the supervision of experienced personnel.

1.6 Intended use

The device is intended exclusively to be used as a tension meter.

Any other use or any use exceeding this intention will be regarded as misuse.

Under no circumstances shall Hans Schmidt & Co GmbH be held liable for damage resulting from misuse.

The intended use also includes:

- Complying with all notices included in the instruction manual and observing all inspection and maintenance works.

1.7 Dangers in handling the device

The device was designed according to the state of the art and the approved safety standards. Nevertheless, its use may cause serious or fatal injury to the user or third persons, and/or an impairment of the device or of other material assets.

The device may only be applied:

- For its intended use in a faultless condition with regard to the safety requirements.
- Malfunctions that could impair safety must be remedied immediately.
- Personal protective equipment must be used according to the EC Directive 89/686/EEC.



The device must not be operated in potential explosive areas and must not come into contact with aggressive substances.

1.8 Copyright

The copyright on these instruction manual remains with the company Hans Schmidt & Co GmbH.

These instruction manual is intended for the operating company and its personnel only. They contain instructions and notices that may only be reproduced on the prior written permission of

Hans Schmidt & Co GmbH

and under indication of the complete reference data.

Violations will be prosecuted.

1.9 Declaration of conformity, RoHs II and WEEE registration

In compliance with the EU Directives 2014/30/EU and 2011/65/EU



Hans Schmidt & Co GmbH is registered in compliance with the German Electrical and Electronic Equipment Act (ElektroG) under WEEE Reg. No. DE 48092317.

2 Available models

2.1 General information

These instruction manual refer to the TS1 model of the TS series; they are also applicable to the following models:

TSP, TSH, TSW, TSL, TSF, TSF1, TSW, TSB1, TSB2

The individual models of the TS series are also available with the following modifications (customized versions):

- Customized measuring head width
- Special tension ranges
- Customized roller dimensions and materials
- Customized distance between outside guide rollers
- Special calibration using customer supplied material

The instruction manual can also be used for these instruments as their handling is the same.

Model numbers:

Model with tension range

*Code for guide rollers
(if not standard)*

*Complete
Order No.*

TS1-1000 + **ASY** = **TS1-1000-ASY**

2.1.1 Available TS1 models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TS1-50	0 - 50	64	PA: 0.12 mm Ø
TS1-100	0 - 100	64	PA: 0.12 mm Ø
TS1-200	0 - 200	64	PA: 0.12 mm Ø
TS1-500	0 - 500	64	PA: 0.20 mm Ø
TS1-1000	0 - 1000	64	PA: 0.30 mm Ø
TS1-2000	0 - 2000	124	PA: 0.50 mm Ø
TS1-5000	0 - 5000	124	PA: 0.80 mm Ø
TS1-10K	0 - 10 daN	124	PA: 1.00 mm Ø
TS1-20K	0 - 20 daN	224	PA: 1.50 mm Ø
TS1-50K	0 - 50 daN	224	Steel rope: 1.5mm Ø (7 x 7 x 0.20)



* Outside dimensions of front plate.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material.

International unit of tensile force: 1 cN = 1.02 g = 0.01 N

1 daN = 1.02 kg = 10.00 N

2.1.1 Available TS1 models (cont.)

TS1 Guide Rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	2000	Hard-coated aluminium
Code K	3500	Hard-coated aluminium
Code H	5000	Plasma-coated aluminium (TS1-100 and higher ranges)
Code ST	1000	Hardened steel
Code B	1000	Tempered steel, specially for measuring tire cord
Code CE2	1000	aluminium ceramic-coated
Asymmetrical Groove Code ASY	1000	Hard-coated aluminium (TS1-500 and higher ranges)
Code ASYB	1000	Tempered steel (TS1-500 and higher ranges)
U-Groove Code U	2000	Hard-coated aluminium (TS1-500 and higher ranges)

2.1.2 Available TSP models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TSP-50	0 - 50	64	PA: 0.12 mm Ø
TSP-100	0 - 100	64	PA: 0.12 mm Ø
TSP-200	0 - 200	64	PA: 0.12 mm Ø
TSP-500	0 - 500	64	PA: 0.20 mm Ø
TSP-1000	0 - 1000	64	PA: 0.30 mm Ø



* Outside dimensions of front plate.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT
calibration material in size, rigidity or shape, we recommend special
calibration using customer supplied material.

International unit of tensile force: 1 cN = 1.02 g = 0.01 N

1 daN = 1.02 kg = 10.00 N

TSP guide rollers:

Ceramic Pins	Line Speed [m/min ... max.]	Pin Material
Standard	6000	Oxide ceramic 5.2 mm Ø

2.1.3 Available TSH models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TSH-1000	0 - 1000	150	PA: 0.30 mm Ø
TSH-2000	0 - 2000	150	PA: 0.50 mm Ø
TSH-5000	0 - 5000	200	PA: 0.80 mm Ø
TSH-10K	0 - 10 daN	200	PA: 1.00 mm Ø
TSH-20K	0 - 20 daN	250	PA: 1.50 mm Ø
TSH-50K	0 - 50 daN	250	Steel rope 1.5 mm Ø (7 x 7 x 0.20)



* Outside dimensions of front plate.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material.

International unit of tensile force: 1 cN = 1.02 g = 0.01 N
1 daN = 1.02 kg = 10.00 N

TSH guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	4000	Stainless steel 1.4125 (max. 4 mm Ø)
U-Groove Code R1	4000	Hard chrome plated steel (3 - 9 mm Ø)
Code R4	1000	Hardened steel (8 - 11 mm Ø) Model TSH-50K and higher
Code R4	1000	Hardened steel (12 - 15 mm Ø) Model TSH-50K and higher
flat Code B6	2000	Hardened steel, width 6 mm
Code B10	2000	Hardened steel, width 10 mm

2.1.4 Available TSW models

Model	Tension Range [daN]	*Measuring Head Width [mm]	Schmidt Calibration Material
TSW-20K	0 - 20	550	steel rope 1.5 mm Ø (7x7x0.25)
TSW-50K	0 - 50	550	steel rope 3 mm Ø (6x7x0.30)
TSW-100K	0 - 100	550	steel rope 4 mm Ø (6x7x0.50)



* Outside dimensions of front plate.


International unit of tensile force: 1 cN = 1.02 g = 0.01 N
1 daN = 1.02 kg = 10.00 N

TSW guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	2000	Hard-coated aluminium (max. 5 mm Ø)
Code R2	2000	Hard-coated aluminium (max. 9 mm Ø)
Code R3	2000	Hard-coated aluminium (max. 15 mm Ø)

2.1.5 Available TSL models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TSL-50	0 - 50	150	PA: 0.12 mm Ø
TSL-100	0 - 100	150	PA: 0.12 mm Ø
TSL-200	0 - 200	150	PA: 0.12 mm Ø
TSL-500	0 - 500	150	PA: 0.20 mm Ø
TSL-1000	0 - 1000	150	PA: 0.30 mm Ø

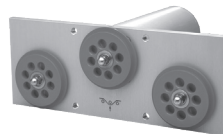

* Outside dimensions of front plate.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material.


International unit of tensile force: 1 cN = 1.02 g = 0.01 N
1 daN = 1.02 kg = 10.00 N

TSL guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	4000	Hard-coated aluminium
Code T	4000	Plastic (PVC red) (same dimensions as standard roller)

2.1.6 Available TSF models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TSF-100	0 - 100	270	PA: 0.12 mm Ø
TSF-200	0 - 200	270	PA: 0.12 mm Ø
TSF-500	0 - 500	270	PA: 0.20 mm Ø
TSF-1000	0 - 1000	270	PA: 0.30 mm Ø
TSF-2000	0 - 2000	270	PA: 0.50 mm Ø
TSF-5000	0 - 5000	270	PA: 0.80 mm Ø

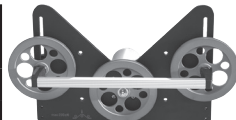

* Outer distance between outside guide rollers.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material.

International unit of tensile force: 1 cN = 1.02 g = 0.01 N

1 daN = 1.02 kg = 10.00 N

TSF guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	5000	Hard-coated aluminium

2.1.7 Available TSF1 models

Model	Tension Range [cN]	*Measuring Head Width [mm]	**Schmidt Calibration Material
TSF1-100	0 - 100	300	PA: 0.12 mm Ø
TSF1-200	0 - 200	300	PA: 0.12 mm Ø
TSF1-500	0 - 500	300	PA: 0.20 mm Ø
TSF1-1000	0 - 1000	300	PA: 0.30 mm Ø
TSF1-2000	0 - 2000	330	PA: 0.50 mm Ø
TSF1-5000	0 - 5000	330	PA: 0.80 mm Ø
TSF1-10K	0 - 10 daN	330	PA: 1.00 mm Ø



* Depending on model, either outside dimension of front plate or outer distance between outside guide rollers.

** Suitable for 95% of applications. PA = Polyamide Monofilament
Should the process material differ significant from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material.

International unit of tensile force: 1 cN = 1.02 g = 0.01 N


1 daN = 1.02 kg = 10.00 N

TSF1 guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	5000	Hard-coated aluminium
Code FB	5000	Tempered steel (TSF1-2000 and higher ranges)

2.1.8 Available TSB1 models

Model	*Tension Range [cN]	**Measuring Head Width [mm]	Roller Widths [mm]
TSB1-100	0 - 100	60	7, 10, 15, 20
TSB1-200	0 - 200	60	7, 10, 15, 20
TSB1-500	0 - 500	60	7, 10, 15, 20
TSB1-1000	0 - 1000	60	7, 10, 15, 20
TSB1-2000	0 - 2000	120	7, 10, 15, 20
TSB1-5000	0 - 5000	120	7, 10

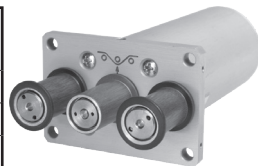

* SCHMIDT calibration with a textile ribbon or film according to tension range and roller width.


** Outside dimensions of front plate.

TSB1 guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	1000	Hard-coated aluminium

2.1.9 Available TSB2 models

Model	Tension Range [cN]	Roller Widths [mm]
TSB2-500	0 - 500	20, 30, 36, 41, 50, 100
TSB2-1000	0 - 1000	20, 30, 36, 41, 50, 100
TSB2-2000	0 - 2000	20, 30, 36, 41, 50, 100
TSB2-5000	0 - 5000	20, 30, 36, 41, 50, 100
TSB2-10K	0 - 10 daN	15, 20, 30, 36, 41, 50, 100
TSB2-20K	0 - 20 daN	15, 20, 30, 36, 41, 50, 100
TSB2-50K	0 - 50 daN	15, 20, 30, 36, 41, 50, 100
TSB2-100K	0 - 100 daN	15, 20, 30, 36, 41, 50, 100

 

TSB2 guide rollers:

V-Groove	Line Speed [m/min ... max.]	Roller Material
Standard	1000	Hard-coated aluminium 13 mm Ø



2.2 Specifications of the TS series

Calibration:	According to SCHMIDT factory procedure
Accuracy:	For 10 % to 100 % of range: ± 1 % full scale Other calibration material: ± 3 % full scale or better
Overload protection:	100 % of range
Measuring principle:	Strain gauge bridge
Meas. roller deflection:	0.5 mm, max.
Natural frequency of measuring spring:	Approx. 500 Hz, depending on tension range
Signal processing:	Analog
Output Signal:	0 - 1 V DC, impedance: ≥ 5 kOhm (standard)
Option code A2:	0 - 10 V DC
Option code A3:	4 - 20 mA
Option code A10	Analog DMS output mV/without amplifier
Damping (f_g):	Standard: approx. 30 Hz (other values on request)
Temperature coefficient:	Zero point: less than ± 0.05 % full scale/°C
Temperature range:	10 - 45 °C
Air humidity:	85 % RH, max.
Power supply:	15 ... 24 V DC, 21 mA (regulated) Code A3: 50 mA (regulated) Code A10: max. 5 V, max. 20 mA (regulated)
Housing:	Aluminium


2.3 Assignment of the connector

- 1

- To assure immunity to random noise, the measuring head must be installed in such a way that it is insulated from ground (GND). The shield of the connecting cable must be connected to the metal housing of the connecting plug.

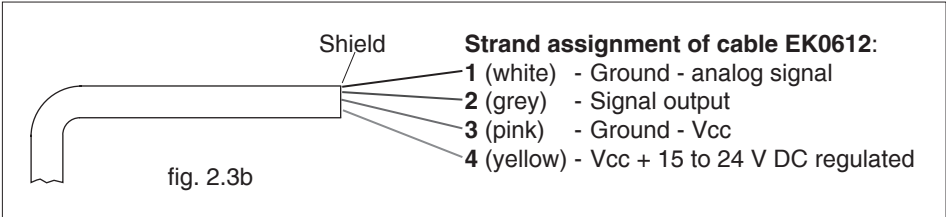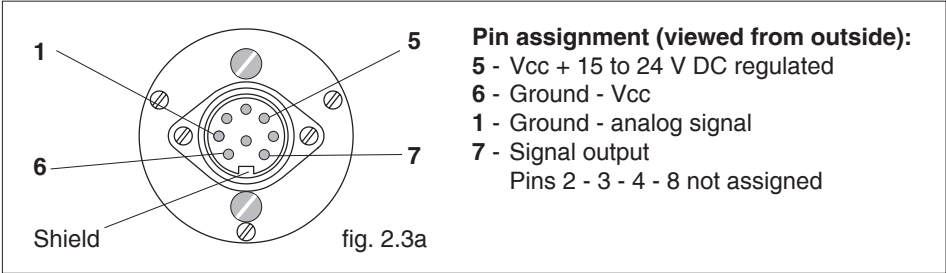

Assignment of the cable for sensors with output signal code A10
(max. cable length 15 m)

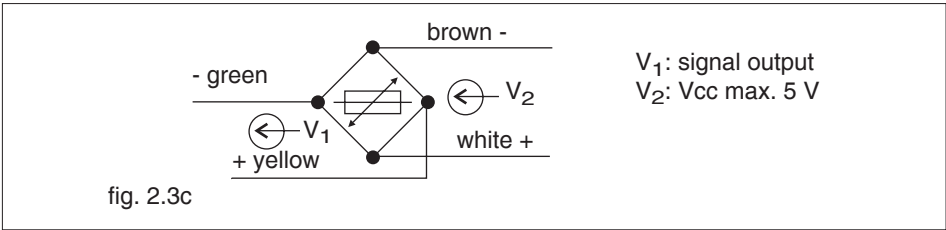

2.3.1 Connecting the tension meter

CE The requirements of the CE specification are only complied with if the tension sensor is equipped and operated with display units and connecting cables supplied by Hans Schmidt & Co GmbH. Certification to the CE specification does not extend to, and shall be invalid for any other combination. Under no circumstances shall Hans Schmidt & Co GmbH be held liable for any damage resulting from the use of non-SCHMIDT sensors or cables.

2.4 Optional accessories

Code **A2**: Analog output 0 - 10 V DC

Code **A3**: Analog output 4 - 20 mA

Code **A10**: Analog DMS output mV/without amplifier

E10061 Diode plug with bayonet cap

EK0603 Connecting cable with 2 diode plugs, length 3 m

EK0605 Connecting cable with 2 diode plugs, length 5 m

EK0610 Connecting cable with 2 diode plugs, length 10 m

EK0612 Connecting cable with 1 diode plug and open ends, length 3 m

EK0614 Connecting cable with 1 diode plug and open ends, length 5 m

EK0615 Connecting cable with 1 diode plug and open ends, length 10 m

2.5 Delivery includes

- Sensor
- Instruction manual

2.6 Unpacking

Unpack the instrument and inspect it for any shipping damage. Notices of defect must be announced immediately, in writing, at the latest within 7 days on receipt of the goods.

3 Operating procedure



Tensions that exceed the tension range of the instrument by more than 100% may cause permanent damage to the measuring spring and must be avoided under any circumstances.

CE conformity testing was carried out and successfully passed by Hans Schmidt & Co GmbH with a complete unit consisting of:

TS sensor, SCD-1 display unit and an 5 m long connecting cable (special cable).

In no event shall Hans Schmidt & Co GmbH take over any warranty coverage for, or shall be held liable for, any damage resulting from self-made cables.



The model number, the serial number, the calibration label (option) and the SCHMIDT Quality Seal are provided on the cylindrical portion of the sensor.

3.1 Initial setup

- Install the sensor at the desired measuring location.
For mounting sensor model TSW at least 8 screws (front plate) had to be used.
- Connect the sensor to the supplied or existing display unit.
The pin assignment of the 8-pin connector located on the rear side of the sensor is described in chapter 2.3
- If the material path is other than vertical or if the process material deviates significantly from the SCHMIDT calibration material, you need to carry out zero adjustment and gain adjustment as described in chapters 3.2.1 and 3.2.2 before starting measurement.
- Allow approx. 10 minutes for thermal stabilization of the sensor.
- Thread the process material through the measuring and guide rollers, following the material path symbol on the front of the sensor.

3.2 Internal adjustment of the sensors

General information:

If the sensor has been delivered with a display unit, the zero and gain adjustments should only be carried out with the supplied display unit.


All tension meters are calibrated with standard materials - such as polyamide monofilament (PA) - according to the SCHMIDT factory procedure; the material path is vertical (TSB2 horizontal). Any difference in process material size and rigidity from the standard material may cause a deviation of the accuracy.

In 95% of all industrial applications the SCHMIDT calibration has been proven to provide the best results and is used for comparative purposes.

If required you can also operate the sensors with a material path other than vertical (TSB2 horizontal).

Should the process material differ significantly from the SCHMIDT calibration material in size, rigidity or shape, we recommend special calibration using customer supplied material. If the material path is other than vertical or if the process material deviates significantly from the SCHMIDT calibration material, you need to carry out static **zero** and **gain** adjustment as described in chapters 3.2.1 and 3.2.2.

3.2.1 Zero adjustment

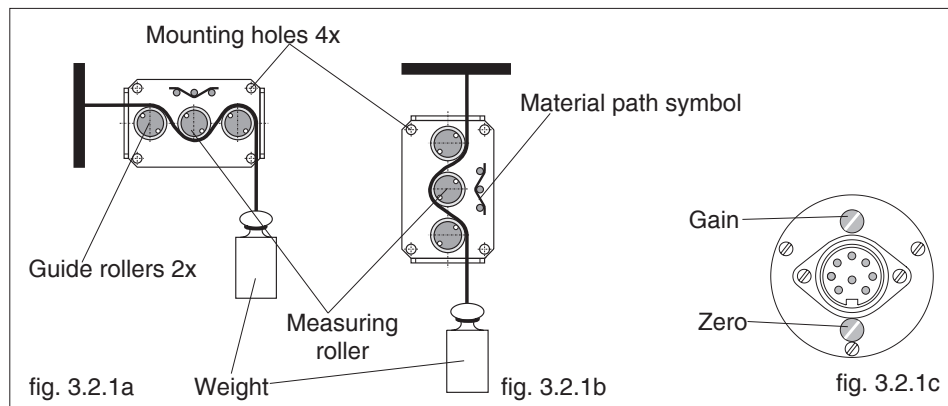

- Install the sensor in the desired position at the measuring location using the provided mounting holes.

3.2.1 Zero adjustment (cont.)

- Screw the countersunk bolts (M2.5) labeled zero and gain all the way out on the rear side of the sensor.
- Allow approx. 10 minutes for thermal stabilization of the sensor.
- Thread the process material through the measuring and guide rollers, following the material path symbol on the front of the sensor.



When threading the process material through the rollers, follow the material path symbol on the front of the sensor. If a force is applied to the middle sensor roller in the incorrect direction, damage could result.



Since zero and gain adjustments are always performed statically, the readings may differ under dynamic load.

- Hang a weight that corresponds to e.g. 10 % of the tension range from the process material.
- Connect a volt meter to pins 1 and 7 of the connector on the rear side of the unit.
- Adjust the potentiometer, which you can reach through the zero hole in the housing, with a screwdriver (with a point width of max. 1.9 mm) until the display of the connected volt meter reads,
for example:
Sensor model TS1-200:
Weight 20 cN = Display 0.100 V for the TS standard version
or
Weight 20 cN = Display 1.00 V for the TS version with 10 V output signal.



Do not insert the screwdriver at an angle as this may damage the potentiometer.

Zero adjustment of sensors with output signal Code A10 has to be realized with display unit SC-PM

3.2.2 Gain adjustment

Requirement: Zero adjustment carried out.

Thread the process material through the measuring and guide rollers, following the material path symbol on the front of the sensor.

- Hang a weight that corresponds to e.g. 95% of the tension range from the process material.
- Adjust the potentiometer, which you can reach through the gain hole in the housing, with a screwdriver (with a point width of max. 1.9 mm) until the display of the connected volt meter reads,
for example:
Sensor model TS1-200:
Weight 190 cN = Display 0.950 V for TS standard version
or
Weight 190 cN = Display 9.50 V for TS version with 10 V output signal.

3.2.2 Gain adjustment (cont.)

- Check the adjustments with a new filament of the process material and repeat the procedure, if required, as described in chapters 3.2.1 and 3.2.2.
- Screw the zero and gain countersunk bolts back in on the rear side of the sensor.



Do not insert the screwdriver at an angle as this may damage the potentiometer.

Gain adjustment of sensors with output signal Code A10 has to be realized with display unit.

4 Service and maintenance

The tension meter is easy to maintain. Depending on operating time and load, the instrument should be checked according to the locally valid regulations and conditions (as described in chapter 3.3). The use of other test methods than the procedure described in chapter 3.3 may cause deviating measuring results.

4.1 Rollers

You should regularly inspect the rollers to assure that they are running easily and smoothly. You can replace the rollers yourself, as necessary. Please indicate the tension meter model and the serial number in your spare-parts order.

5 Cleaning

For cleaning the unit, do not use any



AGGRESSIVE SOLVENTS

such as trichloroethylene or similar chemicals.



NO WARRANTY OR LIABILITY

shall be accepted for damage resulting from improper cleaning.

6 Verification interval

The question of finding the right frequency of calibration accuracy verification depends on several different factors:


- ➔ Operating time and load of the SCHMIDT tension meter
- ➔ Tolerance band defined by the customer
- ➔ Changes to the tolerance band compared to previous calibrations

Therefore, the interval between verifications of calibration must be determined by the user's Quality Assurance Department, based on the user's experience.

Assuming normal operating time and load as well as careful handling of the tension meter, we recommend a verification interval of one year.

6.1 Verification of calibration and determination of repair costs

Flow chart for verifying the calibration of used tension meters, incoming and outgoing verification with Inspection Certificate 3.1 according to DIN EN 10204

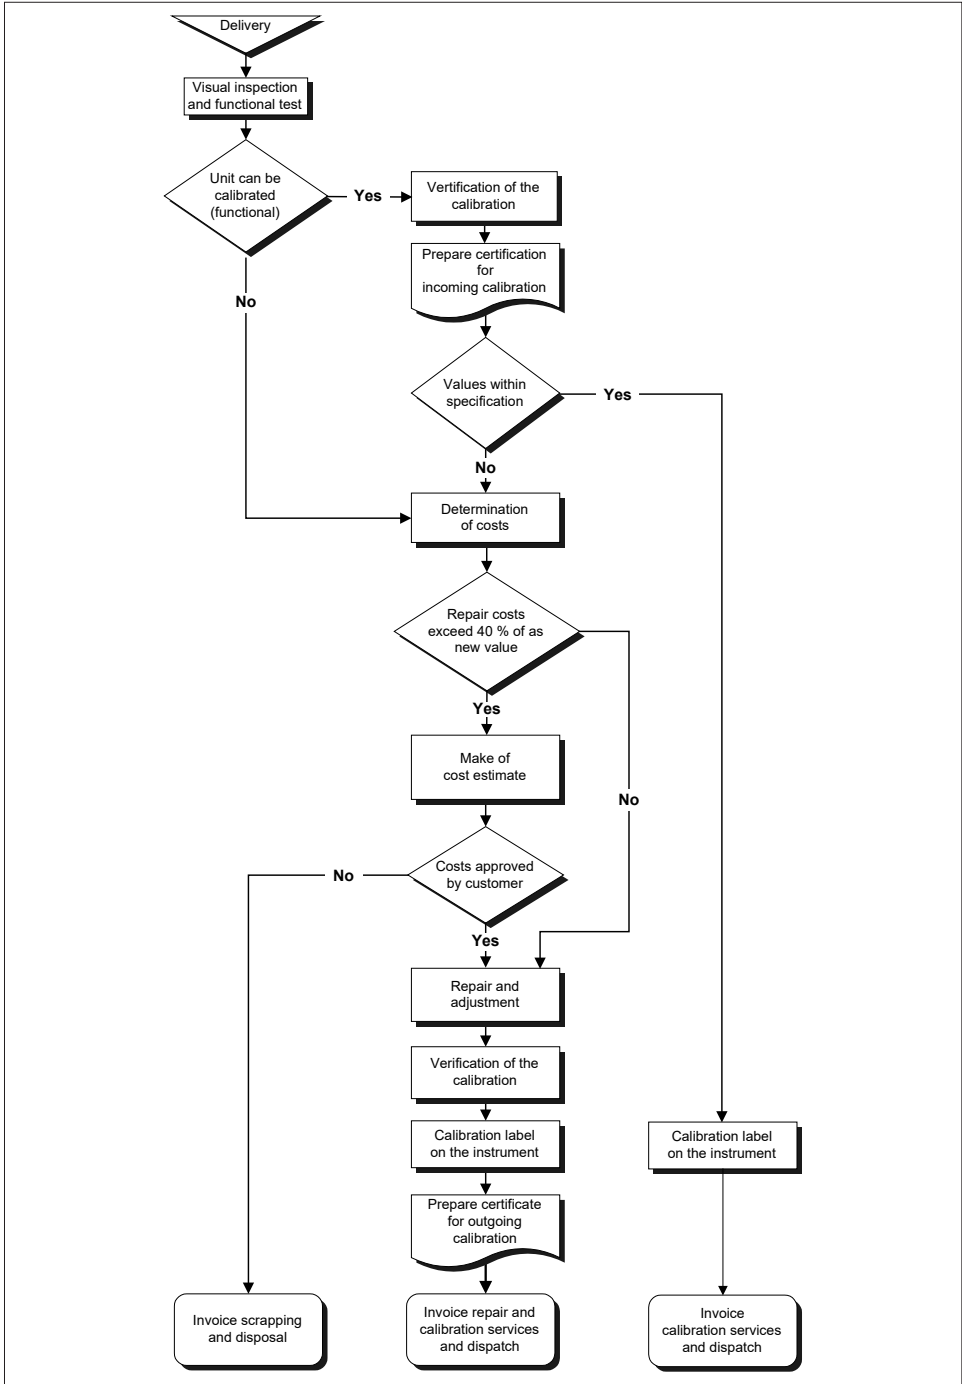



7 Correspondence

Should you have any questions regarding the instrument or instruction manual, or their use, please indicate above all the following details which are given on the ID plate:

- 1) Model
- 2) Serial number

8 Repairs

Shipping instructions:

We kindly ask for return free of charge for us, if possible by airmail parcel. All occurring charges, if any (such as freight, customs clearance, duty etc.), will be billed to customer. For return from foreign countries, we ask you to include a proforma invoice with a low value for customs clearance only, e.g. 50 Euro, each and to advise the shipment in advance by fax or eMail.

- 1**
- To avoid unnecessary follow-up questions, and the resulting loss of time or possible misunderstandings, please return the instrument with a detailed fault description to our service department. Please indicate in your order whether you require an Inspection Certificate 3.1 according to DIN EN 10204.**

Service address:

**Hans Schmidt & Co GmbH
Schichtstr. 16
84478 Waldkraiburg
Germany**

Subject to change without notice!

