

ORION® 950

MOISTURE METER



INSTRUCTION MANUAL

TABLE OF CONTENTS

- 1 Introduction**
- 5 Orion® 950 Parts**
- 6 Quick Start: Basic Use for Solid Wood**
- 13 Correct Usage Guidelines for Your Orion® 950 Moisture Meter**
- 16 Function Buttons: Detailed**
 - ON/HOLD Button
 - UP and DOWN Buttons
 - DEPTH Button
 - SPECIES/MATERIAL Button
 - How to Program a Species Setting
 - Relative Scale for Moisture Measurement of Non-Wood Building Materials
 - DATA Button
 - AUDIO Button

34 Summary of Orion® 950 Features

- Low Battery Alert Indication
- Auto Shut-Down to Preserve Battery Life
- Calibration of your Orion® 950
- Protective Rubber Boot for Your Orion® 950
- 7-Year Warranty
- Wagner’s IntelliSense™ Technology

42 Specifications

43 Changing the Battery

43 Meter Storage

44 Warranty

47 Glossary of Terms

Mobile App



INTRODUCTION

Congratulations!

You have purchased one of the most accurate moisture measurement instruments for wood in the world. Using IntelliSense™ technology, hand-held moisture meters from Wagner Meters have been proven by universities and institutes worldwide to provide superior measurement results.*

With its electromagnetic field, your Orion® 950 moisture meter covers a relatively large cross-sectional area each time you take a reading, giving you a far better representation than other technologies of the true moisture content of your wood.



Wagner moisture meters read **IN** the wood, not just on the wood.

The 2.0-inch (50mm) wide by 2.5-inch (63mm) long by either .25-inch (6mm) or .75-inch (19mm) thick sensor field of your Orion® moisture meter closely approximates the full-thickness cross-section method used when performing the ASTM D4442-16 oven-dry lab method. This ASTM standard (and its international counterparts) is the standard to which all moisture meters for wood are compared for accuracy.

Your Orion® 950 is best-suited for wood thicknesses from .25 inches (6mm) up to 1.5 inches (38mm). The meter can be used on non-solid wood products, and the Species Setting Booklet includes a few settings for some of these common materials.

In the Standard Measurement mode, your Orion® 950 measures moisture content within the 4.0% to 32.0% moisture content range.

NOTE: *Measurement range may vary slightly depending on species setting of the meter.*

The Orion® 950 has an easy-to-read digital display, scaled in 0.1% increments, when in the Standard Measurement mode, for your solid wood applications.

Your Orion® 950 has data collection capacity to store readings and get statistical data. When the data collection mode is activated you will have the ability to store and review up to 100 readings and get the maximum, minimum, and an average of all stored readings.

In addition to dual depth and data collection, your Orion® 950 has the capability to measure and record relative humidity, temperature, dew point, equilibrium moisture content, grains per pound, and grains per kilogram.


Your Orion® 950 also connects to a smart device application, utilizing Bluetooth® technology, so you can receive and record data, set specifications for separate jobs, and much more. Simply scan the QR code on page 49 to arrive at the app location.

Wagner hand-held moisture measurement technology is virtually unaffected by wood temperature.**

Since 1965, Wagner Meters has been providing quality moisture measurement equipment and Wagner's technology has been proven to provide some of the most accurate results in the industry when compared to the ASTM D4442-16 Standard. Wagner meters have been used for years by professional lumber-grading associations, and meters from Wagner continue to provide reliable and consistent moisture measurements, with unsurpassed convenience and ease of use.

***Information available upon request.**Contact a Wagner Meters expert at 844-689-0660 if your wood is very hot or frozen.*

ORION® 950 PARTS

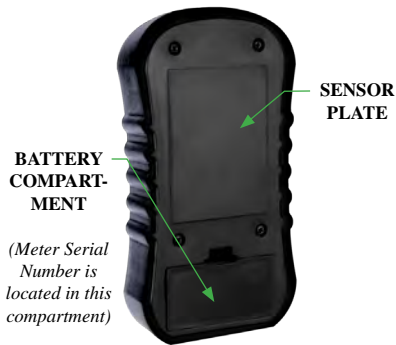

5

QUICK START BASIC USE FOR SOLID WOOD



With your Orion® 950 turned OFF, press and release the ON/HOLD button. Meter will turn on and briefly display the model number, followed by the firmware revision number. If this is the first time you are using your new Orion® 950, immediately after the revision number is displayed, the meter display should revert to Standard Measurement mode, with the display showing 0.0% when the meter is held in the air. If meter display does not show 0.0%, then refer to page 19 regarding the SPECIES/MATERIAL button.



Next, press the DEPTH button to put the meter in the Depth Setting mode and press either the UP button, DOWN button or DEPTH button. The Depth setting will change from 3-4 or 3/4" to 1-4 or 1/4" or vice versa. Press the ON/

6

HOLD button to store the setting and return the meter to the Reading Mode.



Press the DATA button and the word DATA will appear briefly on the display, immediately followed by the word OFF. Next, using the

UP or DOWN button, either turn data ON for collecting data manually or to AUTO if you want the data collected automatically. Once you have made your selection, press the ON/HOLD button to activate the selected data storage function.

If you chose the ON mode for collecting the data, place the meter on the wood to be measured and press the ON/HOLD button briefly to gather a data point. You will hear a beep as the data is gathered. The number of the data point will be displayed and then the moisture recorded will be displayed.

If you choose the Automatic mode, place the meter on the wood to be measured. Wait briefly until you hear a beep. The meter will display the reading number and then the

reading taken. Move the meter to the next sample for more readings.

When done sampling wood, turn the Automatic Data Recording mode OFF by hitting the data button again. This will stop the recording of data.

After the data has been collected, press the DATA button twice and the maximum reading will be shown (MAX). Subsequent presses of the DATA button will show the minimum (MIN) average of all stored readings (AVG). Press the DATA button once more and all individual recorded readings can be viewed (REC). Use the UP or DOWN button to scroll through the individual readings. To clear individual readings, press the UP and DOWN buttons simultaneously. CLR D will show on the display followed by NO. Press the UP or DOWN button to select YES, then press the DATA button to clear the reading. Press the DATA button once more and CL ALL will flash, followed by NO. To clear all data, use the UP or DOWN button to select YES and then press the DATA button to activate the clear function. (Note: There is

no prompt after pressing the DATA button. All stored data will be erased.)



Next, press the SPECIES/MATERIAL button once, and the current species setting (calibrated to specific gravity) will appear. The factory default displayed will be 0.50 for a new meter. Use the UP or DOWN arrow buttons to set the correct species setting for the wood species you wish to measure (refer to your Species Settings Booklet to find the correct setting). Finally, press the ON/HOLD button to place the meter back in the Standard Measurement mode.



NOTE: *If you cannot find the correct setting for the wood species or material you wish to measure, go to www.wagnerspecies.com where you can access Wagner's extensive Species Database. If you still cannot find the correct setting, contact a Wagner Meters expert at 844-689-0660.*

A small DP will appear in the lower left corner of the screen to visually indicate that you are in 3-4 (3/4") Depth Setting mode (Deep mode).

Grasping the meter on the sides, begin taking measurements on the face of the wood pieces by pressing down firmly, making sure the rectangular sensor plate area on the back of the meter is pressing firmly on the wood surface and completely covered by the wood. Minimum wood dimension needs to be 2.0 inches (50mm) wide by 2.5 inches (63mm) long by .75 inches (19mm) in thickness. When taking measurements, make sure there is a 1-inch (25mm) minimum air gap underneath the wood you are measuring (refer to Correct Usage Guidelines section of this manual).



Press the SPECIES/MATERIAL button four times and the Relative Humidity mode will display RH for 3.5 seconds, then it will display the ambient Relative Humidity (e.g., 34.5%). After 3.5 seconds, the mode will change to temperature and DEG (shown

on page 21) will display, then toggle to the ambient temperature (e.g., 75.1F). Note: The temperature display can be changed to Celsius (e.g., 24.0C) by pressing either the up or down arrow key.

On the fifth press of the SPECIES/MATERIAL button, EMC will be displayed, then the display will show the equilibrium moisture content based on the ambient relative humidity and temperature (e.g., 7.5%).

After the sixth press of the SPECIES/MATERIAL button, the display will show DP for 3.5 seconds, then will display the dew point temperature (e.g., 39.1F). Note: The temperature display can be changed to Celsius (e.g., 3.9C) by pressing either the UP or DOWN arrow key.

On the seventh press of the SPECIES/MATERIAL button, the display will show GPP for 3.5 seconds, then the display will show the grains per pound (e.g., 37.1). Note: The display can be changed to grains per kilogram (e.g., 5.2) by pressing either

the UP or DOWN arrow key.



When you are finished taking measurements and wish to turn the meter off, press the ON/HOLD button for approximately 2 seconds. Alternatively, the meter will automatically shut off after approximately 60 seconds of no activity.



CORRECT USAGE GUIDELINES FOR YOUR ORION® 950 MOISTURE METER

To make sure that you are getting the most accurate readings from your Orion® 950 meter, Wagner Meters recommends that you pay close attention to the following guidelines:

1. If the thickness of the piece of wood or other building material is greater than .75 inch (19mm), and you wish to get more of a full thickness rather than a shallow measurement, it is a good idea to take measurements in 3/4" mode on both sides and average the readings.
2. To prevent high or inaccurate readings, always have a minimum 1-inch (25mm) air gap underneath the piece of wood you are measuring. During this process, make sure your hand is not directly underneath the meter.
3. Your Orion® 950 meter was designed for wood thicknesses from .25 (6mm) to .50 (13mm) in 1/4" mode and .75 inches (19mm) up to 1.5 inches (38mm) in 3/4" mode. If you wish to measure wood pieces with thicknesses less than .75 inches (19mm) in 3/4" mode, the meter will underestimate the actual moisture content. Thicknesses that are slightly thinner (example: .625 inches (15.9mm)) will not be underestimated substantially, but the thinner the piece becomes, the more the measurement will be underestimated. For pieces thinner than .50 inches (12.7mm), you should use the 1/4" mode.
4. The actual sensing area is a 2.0-inch (50mm) wide by 2.5-inch (63.5mm) long rectangle on the back of the meter (opposite side of the display). In order to take a valid measurement, this sensing area must be completely covered with the wood or other material you are measuring. If the sensing area is not completely covered, your moisture reading will be inaccurate.

5. If there is visible moisture or water on the surface of the wood or material to be tested, wipe off any excess, and let the surface dry out for a couple of minutes before taking measurements. If possible, turn the board over and measure the other side.
6. Be sure to press down firmly to ensure good sensor plate contact with the surface of the wood or building material. This is especially important when measuring rough-sawn lumber.
7. Do not take readings where there is a noticeable defect or knot in the lumber.

Our Technical Staff Wants to Help You:

Contact us at our worldwide toll-free number, **844-689-0660**, for guidelines to measure wood where measurement corrections may be necessary or if you are measuring lumber that is frozen, salt water-permeated, or is treated with CCA, ACQ, metallic, or other components that might bias the moisture readings.

FUNCTION BUTTONS: DETAILED USAGE INSTRUCTIONS



ON/HOLD Button

When the meter is OFF, pressing and releasing the ON/HOLD button will turn the meter ON, with the meter briefly displaying the model number, followed by the firmware revision number. Immediately after briefly displaying the revision number, the meter will be in the Standard Measurement mode. At this point, the meter is ready to take moisture measurements. Be assured that any settings that you have previously programmed/selected will be active. In other words, turning off the meter will not cause the meter to revert to factory default settings, but will retain whatever settings you programmed it with.

When in the Standard Measurement mode, pressing and releasing the ON/HOLD button will freeze whatever reading is showing on the display. Additionally, the word HOLD

will show in the upper right-hand corner. This HOLD feature is valuable when taking measurements in hard-to-reach places where you cannot see the display.

If the AUDIO function of the meter is turned on (refer to the “Audio Button” section on page 32), the meter will emit a short beep every 4 seconds that the current reading remains on HOLD.

The current reading will remain on the screen until the ON/HOLD button is briefly pressed again, returning the meter back to Standard Measurement mode and HOLD will disappear from view.

***NOTE:** Meter will shut down automatically after 60 seconds if the meter is left on HOLD with no measurement activity. Pressing the ON/HOLD button for 2 seconds will turn the meter off.*



UP and DOWN Buttons

The particular settings mode (SPECIES/MATERIAL or



AUDIO) that you are in at a given time will determine how these buttons will function. Settings values will be increased or decreased, or different functions activated according to the specific instructions outlined for each settings button.



DEPTH Button

Your Orion® 950 meter features dual depth capability that allows you to measure from the surface down to $\frac{1}{4}$ and $\frac{3}{4}$ inch depths depending on the setting you have chosen. If the meter is in the Depth Setting mode and either the UP button, DOWN button or DEPTH button is pressed, the Depth setting will change (e.g., from 3-4 to 1-4) or vice versa. Press the ON/HOLD button to store the setting. If the meter is in the Depth Setting mode and the ON/HOLD button is pressed, the meter will return to the Standard Measurement mode.

If the meter is in Depth Setting mode and on the $\frac{1}{4}$ " (6mm) depth setting, in

addition to displaying '1-4,' the meter will repeatedly flash 2 dashes in a vertical sequence on the digital display screen.

If the meter is in Depth Setting mode and on the ¾" (19mm) depth setting, in addition to displaying '3-4', the meter will repeatedly flash 3 dashes in a vertical sequence on the digital display screen.

***NOTE:** A small DP will appear in the lower left corner of the screen to visually indicate that you are in 3-4 (¾") Depth Setting mode (Deep mode).*



SPECIES/MATERIAL Button

The SPECIES/MATERIAL button on your Orion® 950 is used to place your meter into one of three different modes by pressing the button until you are in the desired mode. The available modes are:

1. Species Settings mode. This mode is for programming the meter to the

correct setting for the wood species you wish to measure. When in this mode, the meter display will indicate settings values from 0.20 up to 1.00. Factory default is 0.50.

- 2. Relative Measurement mode.** Used for obtaining relative, rather than absolute, measurements, typically for non-solid wood applications (example: relative measurements on drywall). When you toggle to this mode, the display will show REL in the lower-left corner of the display when you are in the Standard Measurement mode. More information concerning Relative Scale can be found on page 32.
- 3. Meter Calibration mode.** Follow the instructions on page 37 to perform your own field calibration using the included Orion® On-Demand Calibrator from Wagner.
- 4. Relative Humidity and Temperature mode.** Once in this mode, your meter will be in a relative humidity (RH)

measurement mode (showing 0-100%) and temperature measurement mode (showing 32°F to 110°F or 0°C to 43.3°C) for measuring ambient RH and temperature. Press and release the SPECIES/MATERIAL button until the display shows RH. The display will toggle every 3.5 seconds to display the following:


- RH with a small RH in the middle left corner followed by the ambient RH (e.g., 35.4%).
- DEG with a small TEMP in the upper left corner followed by the ambient temperature in Fahrenheit



(e.g., 75.1F). While the temperature display is active, the display can be

changed to Celsius (e.g., 24.0C) by pressing either the UP or DOWN arrow key.

5. **Equilibrium Moisture Content (EMC) mode.** Based on the ambient RH and temperature, the equilibrium moisture content (EMC) will be shown in this mode (ranging from 0-40.7%). Press and release the SPECIES/MATERIAL button until the meter displays EMC followed by the equilibrium moisture content (e.g., 7.5%).

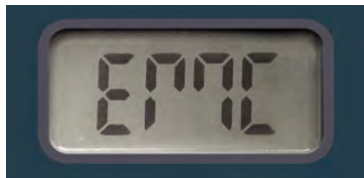

6. **Dew Point mode.** This mode will provide you with dew point temperature ranging from -85°F to 110°F, -65°C to 43°C. Press and release the SPECIES/

MATERIAL button until the meter displays DP followed by the actual dew point temperature in Fahrenheit (e.g., 39.1°F). The display can be changed to Celsius (e.g., 24.0°C) by pressing either the UP or DOWN arrow key.

7. Grains per Pound / Kilogram mode.

This mode displays grains per pound (GPP) from 0-431.1 lb and grains per kilogram (GPK) from 0-61.6 kg. Press and release the SPECIES/MATERIAL button until your meter displays GPP followed by the actual grains per pound (e.g., 46.5). The display can be changed to kilograms by pressing either the UP or DOWN arrow key while 'GPP' is displayed. The display will then show 'GPK' and then will display the correct reading in kilograms (e.g., 6.4).



DATA Button

When the DATA button is pressed, the meter will briefly display DATA and then display either OFF (to indicate the meter is

not set to record data) or ON (if the meter is set to record data) or AUTO (to indicate the meter is set to automatically take readings).

To change the Data Recording mode, press either the UP button or the DOWN button, the display will change from OFF to ON or AUTO and then press the ON/HOLD button, the corresponding Data Recording mode will change.

When the Data Recording mode is ON or AUTO, moisture readings can be stored in the moisture meter. Moisture readings are stored sequentially in the meter up to a limit of 100 readings.

Note: When the meter's Data Recording mode is set for either ON or AUTO, the meter's HOLD function is disabled.

If the meter is in the Standard Measurement mode, the Data Recording mode is set to ON, and the ON/HOLD button is pressed, the meter will record the current reading to the lowest available reading location, display REC at the top and the stored

location (e.g., REC 1) for 0.5 seconds and then return to the Standard Measurement mode. If the maximum of 100 readings has already been reached, the meter will start overwriting the oldest readings and the display will continue to read REC 100.

If the Data Recording mode is set to ON and the meter is turned off, when the meter is turned on again the Data Recording mode will have defaulted to OFF.

- 1. Data Viewing.** When the meter is in Data Recording mode (above) and the DATA button is pressed again, the meter will display MAX and display the highest reading stored. As with the other modes, if there are no readings stored, the meter will display MAX and '----'.

In MAX reading view mode, if the DATA button is pressed again, the meter will display MIN followed by the lowest reading stored. If there are no readings stored, the meter will display MIN and '----'.

If the meter is in MIN reading view mode, and the DATA button is pressed again, the meter will display AVG and immediately display the average of all the readings stored. If there are no readings stored, the meter will display AVG and '- - -'.

When the meter is in AVG reading view mode, and the DATA button is pressed again, the meter will display REC, briefly display the most recent reading's location number (e.g., 4), and then will display the actual moisture reading stored in that location (e.g., 18.2). If the reading is at the meter's maximum of 32.0, the display will show REC MAX along with the actual 32.0 reading. If there are no readings stored in the meter, the display will show REC and '----'.

- 2. View Readings mode.** While in REC (View Readings) mode, if the UP button or the DOWN button is pressed, the next or previous reading location will be displayed (e.g., 2) for 0.5

seconds, and then the meter will display the reading stored at that location (e.g., 18.2).

If the UP button or DOWN button is held down for 0.7 seconds, the current reading location will increase or decrease to the next multiple of 10 (e.g., if the reading location is currently 6, pressing the UP button will change the reading location to 10). Every 0.7 seconds thereafter that the button is held down, the reading location will continue to change by 10 (e.g., from 10 to 10).

When the UP button or DOWN button is released, the reading location that was stopped on will be displayed (e.g., 90) for 0.5 seconds, and then the meter will display the reading stored at that location (e.g., 18.2). All throughout View Readings mode, REC will be displayed to indicate that the user is currently accessing the recorded readings.

If the meter is in the View Readings mode and the DATA button is pressed again, the meter will display CL for 0.7 seconds, ALL for 0.7 seconds, and then display NO. This is called the Clear Reading mode.

- 3. Clear Reading mode.** If the meter is in the Clear Reading mode and either the UP button or the DOWN button is pressed, the display will change from NO to YES.

If the DATA button is pressed when YES is displayed, all readings will be cleared from the meter memory. If the UP button or DOWN button is pressed instead of the DATA button when YES is displayed, the display will change from YES to NO and the meter memory will not be cleared. If the DATA button is pressed while NO is displayed, the meter will return to the Reading mode.

To clear an individual reading, press the UP and DOWN buttons

simultaneously. CLRD will show on the display followed by NO. Press the UP or DOWN button to select YES then press the DATA button to clear the reading.

NOTE: *If the meter is in any of the modes associated with the DATA button (Data Setting, High Reading View, Low Reading View, Average Reading View, or Clear Reading) and the ON/HOLD button is pressed, the meter will return to Reading mode.*

How to Program a Species Setting for Different Wood Species

NOTE: *If you cannot find the correct setting for the wood species or material you wish to measure, go to www.wagnerspecies.com. If you still cannot find the correct setting, contact Wagner at 844-689-0660.*

NEXT, once the meter is turned on, press and release the SPECIES/MATERIAL button until you are in the Species Setting mode. Once you are there, the meter will show the current setting with a decimal (e.g., 0.62 or

1.00). If the meter is being programmed for the first time, the default setting of 0.50 will be displayed on the screen.

While in this mode, pressing and releasing either the UP or DOWN arrow buttons will increase or decrease the setting of the meter by .01 each time a button is pressed and will update the display accordingly.



If the UP button is held down for 0.7 seconds, the setting will increase to the next multiple of .10 (e.g., if the setting is currently .36, the setting will change to .40). Every 0.7 seconds thereafter that the button is held down, the setting will change by another .10 (e.g., from .40 to .50).



If the DOWN button is pressed and held for 0.7 seconds, the setting will decrease to the next multiple of .10 (e.g., if the setting is currently .66, the setting will change to .60). Every 0.7 seconds

thereafter that the button is pressed and held, the setting will change by another .10 (e.g., from .60 to .50).

When pressing the UP arrow button, once the maximum setting of 1.00 has been reached, the setting will wrap around to the minimum (.20) and continue to increase from there. Similarly, when continuing to press the DOWN button, if the minimum setting of .20 has been encountered, the setting will wrap around to the maximum (1.00) and continue to decrease from that point.

Once the species value has been set, press and release the ON/HOLD button to return the meter to Standard Measurement mode. Once in Standard Measurement mode, 0.0 will be displayed on the screen if the meter is held in the air. The programmed setting will be retained in memory even if the meter is powered off or the battery has been changed. If you press and release the SPECIES/MATERIAL button in the future, the last programmed setting will appear on the screen.

Relative Scale for Moisture Measurement of Non-Wood Building Materials

As mentioned earlier, this mode can be entered by pressing and releasing the SPECIES/MATERIAL button until you are in this mode (display will show REL in lower left corner). Once in this mode, your meter will be in a relative measurement scale (0-100) for measuring non-solid wood or non-wood based materials. Press the ON/HOLD button to return to the Standard Measurement mode.



AUDIO Button

Your Orion® 950 AUDIO button allows you to set a high moisture content alarm threshold (setting from 5% to 32%) for solid wood measurement applications, and also set the volume for the audible alarm. This feature is useful, for example, when quickly scanning a piece of wood, and trying to locate any higher moisture content areas, without having to continually look at the digital display.

Press the AUDIO button and the display will show the current moisture content high threshold (e.g., 14%). The factory default is 15%. Each press and release of the UP or DOWN buttons will adjust the threshold setting by 1%.

To get to your desired setting faster, hold down the UP button for 0.7 seconds; the alarm threshold setting will increase to the next multiple of 5 (e.g., if the alarm threshold setting is currently 12%, the setting will advance to 15%). Every 0.7 seconds thereafter that the button is held down, the setting will change by another 5 units (e.g., from 15% to 20%). If the DOWN button is pressed and held for 0.7 seconds, the setting will decrease to the next multiple of 5 (e.g., if the alarm threshold setting is currently 23%, the setting will change to 20%). Every 0.7 seconds thereafter that the button is pressed and held, the setting will change by another 5 (e.g., from 20% to 15%).

Once the setting has been increased to the maximum programmable MC% threshold (32%), the setting will wrap around to the minimum (5%) and continue to increase

from there. Similarly, if the setting has been decreased to the MC% minimum (5%) the setting will wrap around to the maximum (32%) and continue to decrease from there. Again, the range of setting is 5% to 32%, in 1% increments (no decimal place).

Next, press the AUDIO button again, and you will be taken to a display that will show the current volume setting for audible sound. Simply use the UP or DOWN arrow buttons to set the desired audible level. The volume setting has a range of OFF to 9; 9 being the loudest and 1 being the quietest, with OFF indicating that the audible alarm is disabled.

When finished, you can place your meter back to Standard Measurement mode by pressing the ON/HOLD button.


SUMMARY OF ORION® 950 FEATURES

- Digital display resolution of 0.1% (in Standard Measurement mode)
- MC measurement range for wood 4.0% to 32.0%

- Relative scale for testing non-wood building materials
- Programmable settings for a wide range of softwood and hardwood species
- Large moisture measurement sensor area
- Current reading can be frozen on display screen, great for note taking
- Low battery alert indication
- Audible alarm for programmable high moisture content limits
- Programmable audio alert volume
- Can be field-calibrated with the included Orion® On-Demand Calibrator
- Protective rubber boot
- Hard shell storage case and a 9-volt battery are included
- 7-year warranty
- IntelliSense™–Read beyond surface conditions (¾” mode)
- Automatic shutoff when not in use
- Data collection –2 modes: manual or automatic data storage with viewable moisture content stats
- RH, Temperature, EMC, Dew Point, and Grains Per Pound modes work with the free app, via Bluetooth®, which is available for download on page 49.

Low Battery Alert Indication

When the battery is low, BAT appears in the upper right-hand corner of the display. If ignored for too long, the meter will flash a larger BAT three times and then automatically shut down. The 9-volt battery must be replaced immediately.

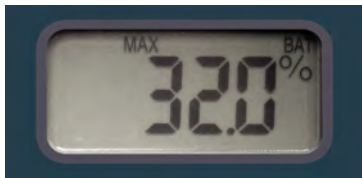

This shut-down action is to prevent inaccurate readings.

Auto Shut-Down to Preserve Battery Life

Regardless of which mode the meter is in, if there is no change in measurement activity over a period of 1 minute, the meter will automatically turn off.


Calibration of Your Orion® 950

If you have reason to believe your Orion® 950 may be out of calibration, it can be easily recalibrated using the provided On-Demand Calibrator. Before calibrating your meter, please be aware that you must **ONLY** calibrate to the correct Calibrator that came with the meter. Serial numbers on the Calibrator (found underneath) and meter (found in the battery compartment) **MUST** match for correct calibration. Also, the sticker must not be damaged, as this may cause incorrect calibration. Follow the steps below for proper calibration. The instructions are also printed on the back of the Calibrator.

1. Place the Calibrator on its legs on a non-metallic surface.
2. Turn the meter on, and then use the SPECIES/MATERIAL button to put your meter in CAL mode. (Refer to the SPECIES/MATERIAL button section of the manual.)
3. Place the meter on the Calibrator,

correctly “seating” the meter sensor pad firmly on the recessed area of the Calibrator. **IMPORTANT:** Failure to correctly and firmly “seat” the sensor pad in the recessed area will cause an inaccurate calibration.

4. Apply light downward pressure and press the AUDIO button three (3) times. The meter will make a “beeping” sound which indicates it is going through the automatic calibration procedure.
5. When the calibration procedure is complete, the meter will display the word LIFT. Immediately remove the meter from the Calibrator and hold the meter in the air for approximately 5 seconds until the word DONE appears on the display. During this last phase in the air, be sure to keep your hand and other objects away from the underside of the meter.
6. Press the ON/HOLD button to return the meter to normal measuring mode.

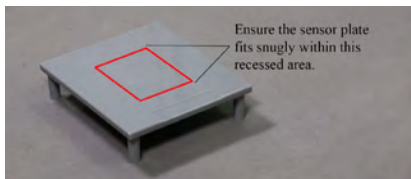

If, after recalibrating the Orion® 950, there is still a problem with the meter, please contact a Wagner representative for further instructions at 844-689-0660.



Protective Rubber Boot for Your Orion® 950

In an effort to help avoid damage resulting from your Orion® 950 meter being dropped or banging the edges against other hard objects, Wagner Meters has provided a fitted rubber boot

which fits snugly around the perimeter of your Orion® 950 meter.

This protective boot should remain in place at all times even when calibrating your meter

on the On-Demand Calibrator.* All function buttons as well as the display screen, sensing plate, and battery compartment are accessible without removal of this rubber guard. The boot will fit on the meter only one way correctly. Failure to correctly place the boot will result in inaccurate readings.

**Although not recommended, you may wish to use the meter without the protective rubber boot. If you choose to do so, make sure you recalibrate your meter on the On-Demand Calibrator with the boot off.*

7-Year Warranty

Wagner Meters offers an industry-best 7-year warranty on your Orion® 950 moisture meter.



Register your meter at
www.genuinewagner.com

Wagner's IntelliSense™ Technology*

Your Orion® 950 moisture meter features Wagner's IntelliSense™ technology, going beyond the surface conditions for accurate measurements of moisture conditions inside the wood.

Most pinless meters are unable to distinguish between surface or ambient conditions on the surface of the wood, and the real moisture picture in the wood. Pin-type meters may be able to bypass the surface conditions, but they also damage the surface of the wood each time you take a reading. Air humidity, condensation, or other ambient conditions can impact many moisture meters and give inaccurate readings that cost you money. However, Wagner Meters' hand-held moisture meters with IntelliSense™ technology measure moisture IN the wood, not ON the wood, giving fast, highly accurate moisture measurement for woodworking or wood flooring projects. In addition, it works without damage to the wood surface!

* IntelliSense™ active in 3/4" mode only.

SPECIFICATIONS

Dimensions with Boot

- Length: 5.75 inches (146mm)
- Width: 3.0 inches (76mm)
- Thickness: 1.0 inches (25mm)

Scanning Area

- 2.0 inches (50mm) x 2.5 inches (63mm)

Weight with Boot

- 7.2 oz. (204g)

Power

- 9-volt battery (Wagner recommends using non-rechargeable Alkaline or Lithium, or rechargeable NiMH batteries)

Auto Power Shut-Down

- 60 seconds

Measurement Ranges

- MC range for wood: 4.0% to 32.0%

Specific Gravity Range for Wood Species

- 0.20-1.0 SG

Storage Temperature and Humidity

- +50°F to +90°F (+10°C to +32°C), Maximum relative humidity of 95%, non-condensing

Operating Temperature

- +32°F to +110°F (+0°C to +43°C)

CHANGING THE BATTERY

As indicated earlier in this manual, if BAT appears on the display, the battery must be changed immediately or any further moisture measurements will be inaccurate. Replace with 9-volt, non-rechargeable Alkaline or Lithium or rechargeable NiMH batteries. Be sure to observe proper battery polarity. The battery fits very snugly in its compartment and will not become dislodged while taking measurements. Reattach the compartment door carefully so that it snaps back in place.

METER STORAGE

When meter is not in use, we recommend that it be stored in the hard shell carrying case provided with each Orion® 950 meter. If meter is to be stored for a period longer than 30 days, remove the 9-volt battery.

WARRANTY

Wagner recommends that you register your moisture meter at www.genuinewagner.com for faster support and benefits.

Wagner Meters' warranty offers this product protection against defects in material and workmanship for seven (7) years from the date of purchase on all Orion® 950 moisture meters, subject to the following terms and conditions:

Wagner Meters' liability under this warranty shall be limited, at Wagner Meters' option, to the repair or replacement of this product or any part thereof, which is demonstrated to be defective. To exercise this warranty, visit www.genuinewagner.com for instructions. This limited warranty does not apply if Wagner Meters determines that the product has been damaged by accident, negligent handling, misuse, alteration, damage during shipment, or improper service not attributed solely to the actions of Wagner Meters. Wagner Meters' liability for any

defect in material or workmanship in this product shall be limited to the amount of purchase price of the product.

With proper care and maintenance, the meter should stay in calibration; however, because Wagner Meters has no control over the manner in which the unit will be used, it makes no guarantee that the meter will stay in calibration for any specific period of time. Wagner Meters recommends returning the unit to the factory for a diagnostic checkup in the event the meter is dropped or otherwise damaged. If the meter is suspected to be inaccurate, using the provided On-Demand Calibrator and performing a recalibration will ensure the meter is reading correctly. If the meter fails to calibrate properly then it should be sent to the factory for a diagnostic checkup.

When instructed to return a meter, the meter should be returned with the Calibrator that matches the serial number of the meter.

This warranty is in lieu of all other warranties, whether oral or written, express or implied.

THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION OF THE FACE HEREOF. WAGNER METERS HEREBY DISCLAIMS ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Under no circumstances shall Wagner Meters be liable for any incidental or consequential damages. Agents and employees of Wagner Meters are not authorized to make modifications to this warranty or additional warranties binding on Wagner Meters. Accordingly, additional statements, whether oral or written, except written statements from an officer of Wagner Meters, do not constitute warranties and should not be relied upon by the customer.

This warranty is personal to the customer purchasing the product from Wagner Meters or Wagner Meters' authorized distributors, and is not transferable.

Technical Support/Repair Contact

Worldwide Toll-Free: 844-689-0660

Glossary of Terms

Relative Humidity

The amount of water vapor in the air, expressed as a percentage of the maximum amount that the air could hold at the given temperature.

Temperature

The degree or intensity of heat present in a substance or object, especially as expressed according to a comparative scale and shown by a thermometer or perceived by touch.

EMC (Equilibrium Moisture Content)

The moisture content of wood is directly related to the humidity and temperature of the surrounding air. The EMC occurs when the wood has reached an equilibrium with its environment and is no longer gaining or losing moisture.

Dew Point

The atmospheric temperature (varying according to pressure and humidity) below which water droplets begin to condense and dew can form.

GPP/GPK (Grains Per Pound/Kilogram)

In simple terms, a grain is a unit of measurement for weight. It is used to determine the specific amount of water present in a pound/kg of air. On average, one pound of air has a volume of 14 cubic feet (178.4 cubic liters) and a weight of 7000 grains (3150 grains metric). This means that one grain equals 1/7000th of a pound (1/3150 kilogram). GPP/GPK shows the actual weight of water vapor in the air. It is often referred to as “specific humidity” or “humidity ratio.”

Mobile App

Notes

Wagner Meters offers a free mobile app that links your Orion® 950, through a Bluetooth® connection, to your Android™ or Apple® smart device to receive and record data, set specifications for separate jobs, and much more.

To download and install the app, simply scan the QR code below to arrive at the app location.



Scan this code to install the app